



Grounded in Quality

A proud member of the Hunter Construction Group

Karuah East Quarry

Environmental Monitoring Report:

March 2023



Table of Contents

1	Introduction	3
2	Air Quality Monitoring	4
2.1	Deposited Dust Monitoring	5
2.2	High Volume Air Sampling	5
3	Blast Monitoring	7
4	Noise Monitoring	8
4.1	Attended Monitoring	8
4.2	Unattended Noise Monitoring	8
5	Surface Water Monitoring	11
5.1	Monthly Surface Water Monitoring Program	11
5.2	Discharge Monitoring	14
5.2.1	Dam 1 (LDP1)	14
5.2.2	Dam 2 (LDP2)	14
5.2.3	Dam 3 (LDP3)	14
6	Weather Monitoring	15
7	Reporting	18
7.1	Community Consultative Committee	18
7.2	Production	18
7.3	Non-Compliance	18
7.4	Complaints	18
Table 1 Environmental Protection Licence 20611 information		3
Table 2 Project Approval 09_0175 information		3
Table 3 PA 09_0175 Long Term Assessment Criteria for Deposited Dust		4
Table 4 PA 09_0175 Long Term Impact Assessment Criteria for Particulate Matter		4
Table 5 PA 09_0175 Short Term impact Assessment Criterion for Particulate Matter		4
Table 6 Air quality monitoring locations		4
Table 7 Deposited dust monitoring results		5
Table 8 High Volume Air Sampling ($\mu\text{g}/\text{m}^3$) results		5
Table 9 Blasting criteria		7
Table 10 Blast monitoring results		7
Table 11 Operational Noise Criteria (dB(A) $\text{LA}_{\text{eq}(15\text{min})}/\text{LA}_{(\text{max})}$)		8
Table 12 Noise monitoring locations		8
Table 13 Attended Noise Monitoring (EMM, February 2023)		9
Table 14 Water monitoring results		12
Table 15 EPL20611 - Pollutant concentration limits		14
Table 16 Discharge monitoring – LDP1		14
Table 17 Discharge monitoring – LDP2		14
Table 18 Discharge monitoring – LDP3		14

Table 19 Non-compliance Register	18
Table 20 Complaints Register	18

Figure 1 HVAS Sampling Long-term Trends	6
Figure 2 Weather Summary - March 2023.....	16
Figure 3 Wind Rose - March 2023.....	17

Appendix 1

Monitoring Locations

1 INTRODUCTION

This report has been completed to meet the requirements of Section 66(6) of the *Protection of the Environment Operations Act 1997* and the NSW Environmental Protection Authority's (EPA) *Requirements for Publishing Pollution Monitoring Data* (EPA, 2013). This report summarises the required monitoring data under *Environmental Protection Licence 20611* (the EPL) (see Table 1) and *Project Approval 09_0175* (the Consent) (see Table 2) for Karuah East Quarry (the Quarry).

Table 1 Environmental Protection Licence 20611 information

Environmental Protection Licence Number	20611
Licensee's Name	Karuah East Quarry Pty Limited
Licensee's Address	Licensee Postal Address: PO Box 3284 Thornton NSW 2322. Premises Address: Karuah East Quarry, Blue Rock Close, Karuah NSW 2324.
Link to Full Licence on the EPA Website	https://apps.epa.nsw.gov.au/prpoeoapp/

Table 2 Project Approval 09_0175 information

Development Application	PA 09_0175
Applicant	Karuah East Quarry Pty Limited
Approval Authority	Minister for Planning
Link to Full Development Approval on Major Projects Planning Portal	https://www.planningportal.nsw.gov.au/major-projects/project/15026

A summary of the environmental monitoring data for March 2023 is covered in this report.

Tables throughout this report provide key monitoring information from the EPL and the Consent, such as:

- location of monitoring;
- pollutant;
- unit of measurement; and
- monitoring frequency required.

Monitoring locations are identified in Appendix 1.

2 AIR QUALITY MONITORING

Dust emissions generated by the Quarry operation must not cause additional exceedances of ambient air quality criterion outlined in *Schedule 3, Condition 13* of the Consent (see Table 3, Table 4 and Table 5). Deposited dust and TSP/PM₁₀ monitoring is undertaken at the locations listed in Table 6.

Table 3 PA 09_0175 Long Term Assessment Criteria for Deposited Dust

Pollutant	Averaging Period	Maximum Increase in Deposited Dust Level ¹	Maximum Total Deposited Dust Level ¹
Deposited dust	Annual	2 g/m ² /month	4 g/m ² /month

Note 1: Deposited dust is assessed as insoluble solids as defined by AS 3580.10.1-2003.

Table 4 PA 09_0175 Long Term Impact Assessment Criteria for Particulate Matter

Pollutant	Average period	Criterion
Total suspended particulate (TSP) matter	Annual	90 µg/m ³
Particulate matter <10 µm (PM ₁₀)	Annual	30 µg/m ³

Table 5 PA 09_0175 Short Term impact Assessment Criterion for Particulate Matter

Pollutant	Averaging period	Criterion
Particulate matter <10 µm (PM ₁₀)	24 hour	50 µg/m ³

Table 6 Air quality monitoring locations

Site ID	EPL ID	Location	Address	GPS Coordinates
DDG 1	MP 4	South-West of Karuah East Quarry	5760 Pacific Hwy, Karuah NSW 2324	32°38'04"S 151°59'58"E
DDG 2	MP 5	South-West of Karuah East Quarry	5770 Pacific Hwy, Karuah NSW 2324	32°38'02"S 152°00'09"E
DDG 3	MP 6	South-West of Karuah East Quarry	DP 1024341, Karuah	32°37'57"S 151°59'41"E
DDG 4	MP 7	East of Karuah East Quarry	21 Halloran Rd North Arm Cove NSW 2324	32° 37' 30.87"S 152°01'10.18"E
DDG 5	MP 8	South-West of Karuah East Quarry	Lot 21 DP 1024341 Karuah NSW 2324	32° 37' 55.33"S 152°00'2.74"E
HVAS (TSP/PM ₁₀)	MP 9	South-West of Karuah East Quarry	5770 Pacific Hwy, Karuah NSW 2324	32°38'03"S 152°00'09"E

All dust monitoring is undertaken in accordance with the *Approved Methods of Sampling and Analysis of Air Pollutants in NSW* (EPA, 2022).

2.1 DEPOSITED DUST MONITORING

Deposited dust results for the twelve months prior to and including February 2023 are shown in Table 7.

Table 7 Deposited dust monitoring results

Date On	Date Off	DDG 1	DDG 2	DDG 3	DDG 4	DDG 5
5/04/2022	5/05/2022	0.1	0.3	0.1	0.2	0.2
5/05/2022	3/06/2022	0.4	0.6	0.4	0.3	0.3
3/06/2022	5/07/2022	0.3	0.2	0.2	0.2	0.3
5/07/2022	3/08/2022	0.3	0.3	0.4	0.7	0.4
3/08/2022	2/09/2022	0.9	0.9	0.6	1.0	0.9
2/09/2022	4/10/2022	0.5	0.2	0.6	0.3	0.8
4/10/2022	3/11/2022	0.2	0.5	0.5	0.3	0.3
3/11/2022	5/12/2022	0.8	0.8	0.7	1.2	2
5/12/2022	5/01/2023	0.7	0.7	0.3	0.6	0.1
5/01/2023	3/02/2023	0.2	0.4	0.8	0.1	0.4
3/02/2023	5/03/2023	0.9	0.7	0.2	0.3	0.8
5/03/2023	5/04/2023	1.1	1.5	1.1	1.1	1.1
YTD average		0.5	0.6	0.5	0.5	0.6

Monitoring results indicate that for the period from 5 March 2023 to 5 April 2023 the insoluble solid levels recorded at DDG 1 to DDG 5 monitoring locations were below the project criterion of 4 g/m²/month over an annual averaging period.

2.2 HIGH VOLUME AIR SAMPLING

The TSP and PM₁₀ results for March 2023, and a progressive annual average are shown in Table 8. Figure 1 illustrates the year-to-date results for HVAS monitoring.

Table 8 High Volume Air Sampling (µg/m³) results

Run Date	HVAS TSP (µg/m ³)	HVAS PM ₁₀ (µg/m ³)
6/03/2023	40	23
12/03/2023	22	14
18/03/2023	32	22
24/03/2023	16	11
30/03/2023	16	11
24hr Average Criteria¹	N/A	50
Annual Average Criteria¹	90	30
Progressive Annual Average²	20.5	12.5

Note: ¹ Criteria as specified in PA 09_0175.

² The progressive annual average is from 01/01/2023 to 30/03/2023, this is not a measure of compliance.

All HVAS monitoring results for March 2023 were compliant with the long term and short term impact assessment criteria outlined in *Schedule 3 Condition 13* of the Consent (see Table 3, Table 4 and Table 5).

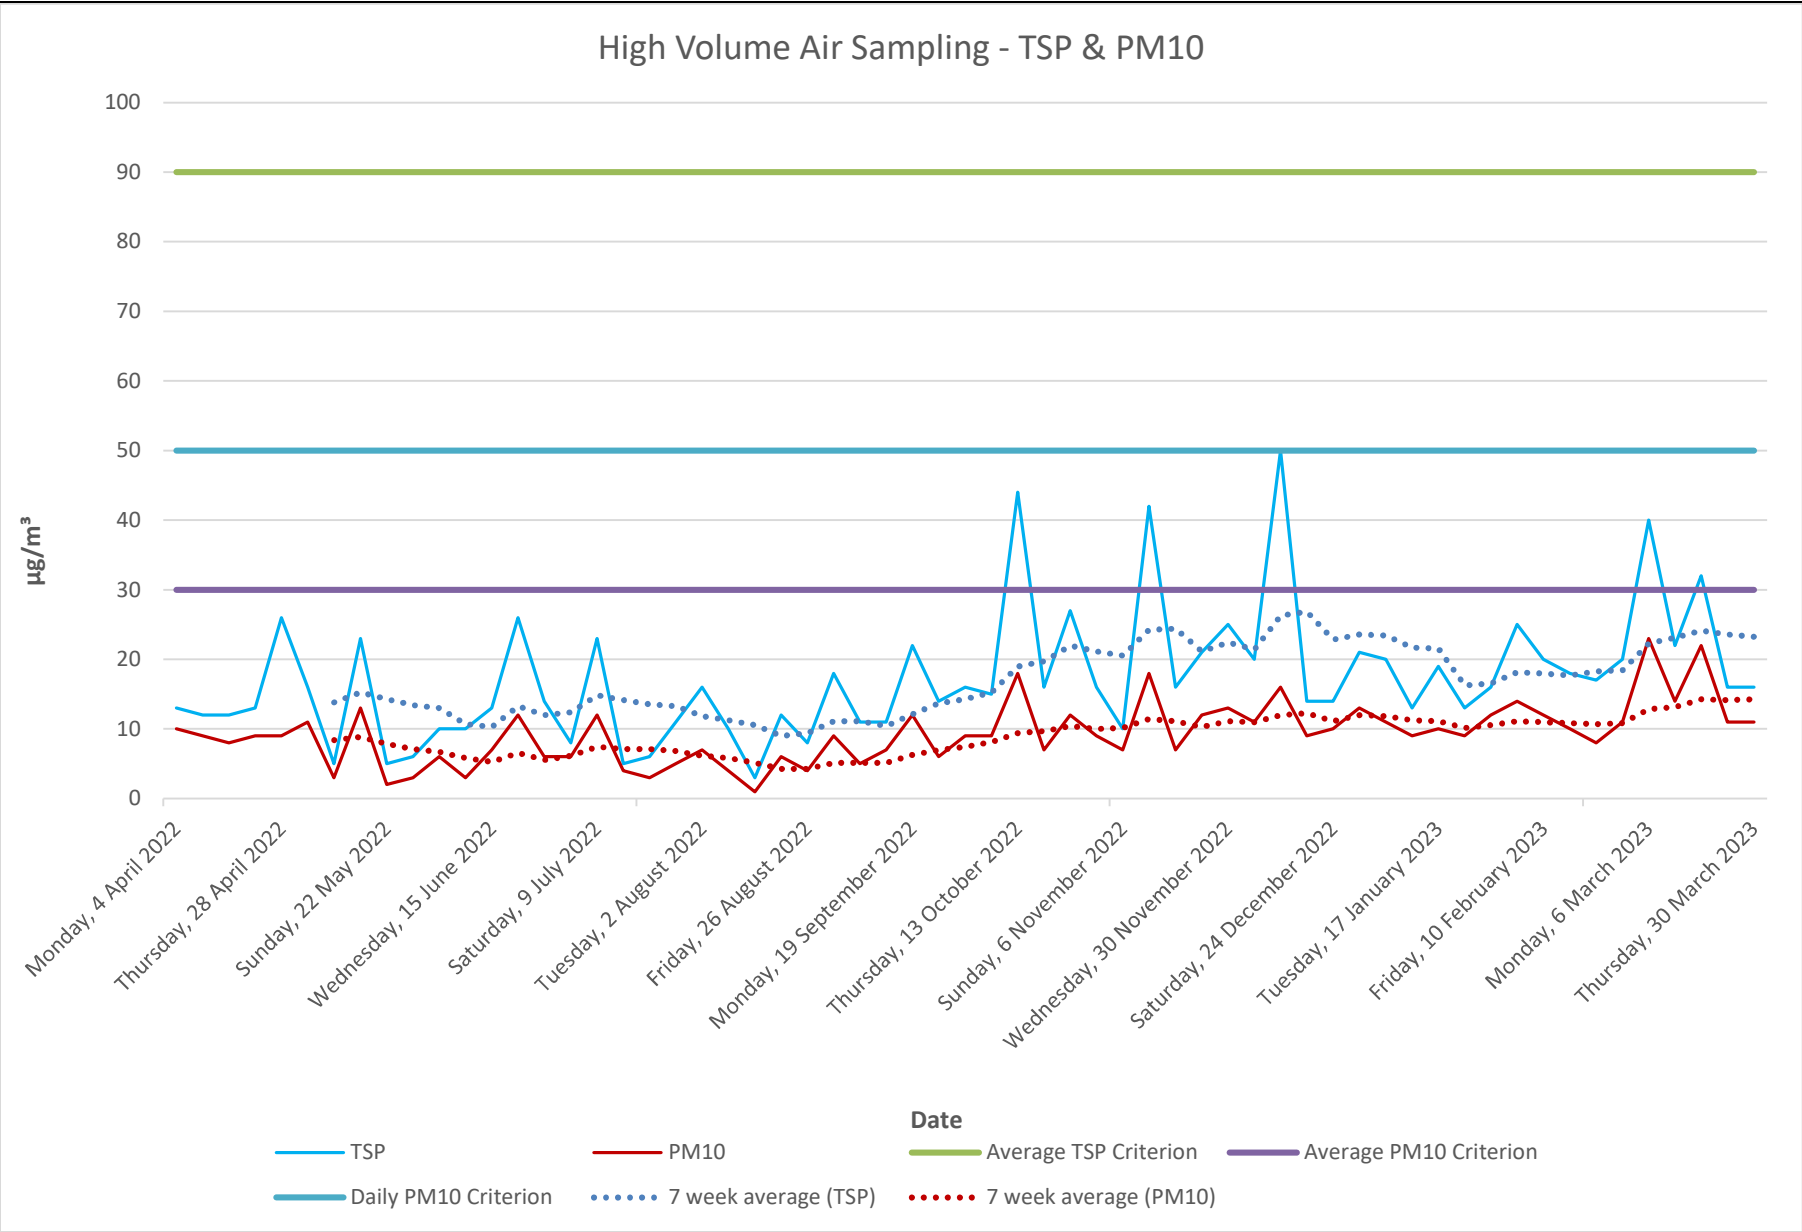


Figure 1 HVAS Sampling Long-term Trends

3 BLAST MONITORING

Blasting must only be carried out between the hours of 9:00 AM and 4:00 PM Monday to Friday. No blasting is permitted on Saturday, Sundays, or Public Holidays. Blasting outside of the hours specified by the EPL/Consent, can only take place with the written approval of relevant regulatory authorities.

KEQ conduct monitoring at the nearest residential location (EPL 20611 EPA identification no. 11) to ensure that airblast overpressure level and ground vibration peak particle velocity do not exceed the EPL and Consent criteria (see Table 9).

Table 9 Blasting criteria

Location	Airblast Overpressure (Decibels (Linear Peak))	Ground Vibration Peak Particle Velocity (Millimetres/second)	Allowable exceedance
Private residence (Location B)	120	10	0%
	115	5	5% of total blasts over 12 months

There was one blast conducted in March 2023, see Table 10 for monitoring results.

Table 10 Blast monitoring results

Date	Time	Location	Overpressure (dB(L))	Vibration (mm/s)
Tuesday, 14 March 2023	2:02pm	RL 120 + 105	108.8	1.01

The monitoring results demonstrate compliance with blasting criteria of the Consent and the EPL.

4 NOISE MONITORING

Noise monitoring is undertaken in accordance with the approved *Noise Management Plan* (April, 2022).

As the Quarry is operational with no construction activities being completed, construction noise is not being considered. Table 11 summarises the operational noise criteria.

Noise generated by the Quarry operation must not exceed the criteria specified in *Schedule 3, Condition 3* of the Consent at each location outlined in Table 11.

Table 11 Operational Noise Criteria (dB(A) $L_{Aeq(15min)}/L_{A(max)}$)

Monitoring Location ID	Description	Easting (MGA)	Northing (MGA)	Applicable noise limit, dB		
				Morning Shoulder $L_{Aeq(15\text{ minute})}/L_{Amax}$	Day $L_{Aeq(15\text{ minute})}$	Evening $L_{Aeq(15\text{ minute})}$
A	Mill Hill Close West	406623	6388704	35/52	42	40
B	Mill Hill Close West	406405	6388859	35/52	40	40
F	The Branch Lane West	405639	6389782	35/52	40	35
G	Halloran Road South	408154	6389523	35/52	43	39
H	Halloran Road West	407795	6389868	35/52	44	46

In accordance with the Consent, a noise monitoring program has been implemented. A summary of this monitoring program is outlined in Table 12.

Table 12 Noise monitoring locations

Monitoring Method	Location	Frequency	Criteria
Attended noise monitoring	A, B, F, G, H	Quarterly	Refer to Table 11

4.1 ATTENDED MONITORING

The most recent results for attended monitoring, undertaken 7 February and 8 February 2023 (see Table 13), show ambient noise levels include noise sources such as traffic from the nearby Pacific Highway and wildlife such as insects and birds. The Quarry operations were audible at location G and H during day and evening period. Monitoring for all locations across all periods was compliant with the criteria.

4.2 UNATTENDED NOISE MONITORING

A review of the historical unattended noise monitoring data by expert noise consultants (EMM) found no evident trends associated with Karuah East Quarry operations. As a result of this review, Karuah East Quarry has decided to cease the unattended noise monitoring component of the quarterly compliance noise monitoring program.

Table 13 Attended Noise Monitoring (EMM, February 2023)

Location	Start Date and Time (Period)	Wind		Stability Class	Limits apply? ¹	Limit, dB		Site level, dB ²		Exceedance, dB	
		Speed m/s	Direction ⁴			L _{Aeq,15minute}	L _{Amax}	L _{Aeq,15minute}	L _{Amax}	L _{Aeq,15minute}	L _{Amax}
A	7/02/2023 5:00 (MS)	1.1	101	F	Y	35	52	IA	IA	No	No
B	7/02/2023 5:16 (MS)	1.0	127	F	Y	35	52	IA	IA	No	No
F	7/02/2023 5:34 (MS)	1.2	97	F	Y	35	52	IA	IA	No	No
G	7/02/2023 5:58 (MS)	0.9	123	F	Y	35	52	IA	IA	No	No
H	7/02/2023 6:15 (MS)	0.8	111	F	Y	35	52	IA	IA	No	No
A	7/02/2023 7:00 (D)	0.7	145	A	Y	42	N/A	IA	N/A	No	N/A
B	7/02/2023 7:16 (D)	0.6	133	A	Y	40	N/A	IA	N/A	No	N/A
F	7/02/2023 7:34 (D)	0.4	101	A	Y	40	N/A	IA	N/A	No	N/A
G	7/02/2023 8:18 (D)	1.1	118	A	Y	43	N/A	<30	N/A	No	N/A
H	7/02/2023 8:35 (D)	1.3	114	A	Y	44	N/A	<30	N/A	No	N/A

Location	Start Date and Time (Period)	Wind		Stability Class	Limits apply? ¹	Limit, dB		Site level, dB ²		Exceedance, dB	
		Speed m/s	Direction ⁴			L _{Aeq,15minute}	L _{Amax}	L _{Aeq,15minute}	L _{Amax}	L _{Aeq,15minute}	L _{Amax}
A	8/02/2023 18:01 (E)	3.6	144	D	N	40	N/A	IA	N/A	No	N/A
B	8/02/2023 18:17 (E)	2.9	141	E	Y	40	N/A	IA	N/A	No	N/A
F	8/02/2023 18:35 (E)	2.9	135	E	Y	35	N/A	IA	N/A	No	N/A
G	8/02/2023 18:59 (E)	1.8	135	F	Y	39	N/A	IA	N/A	No	N/A
H	8/02/2023 19:16 (E)	1.8	154	F	Y	46	N/A	IA	N/A	No	N/A

- Notes:
1. Noise emission limits do not apply during periods of rainfall or winds greater than 3 metres per second (at a height of 10 metres).
 2. Site-only L_{Aeq,15minute}, includes modifying factor penalties if applicable.
 3. NA in exceedance column means criterion was not applicable due to atmospheric conditions outside those specified in project approval.
 4. Degrees magnetic north, "-" indicates calm conditions.
 5. MS = Morning Shoulder period; D = Day period; E = Evening period.

5 SURFACE WATER MONITORING

5.1 MONTHLY SURFACE WATER MONITORING PROGRAM

Monthly water monitoring was undertaken on 3 March 2023 in accordance with the *Surface Water Monitoring Program* outlined in the *KEQ Water Management Plan (2015)*. Results are displayed in Table 14 along with the EPL discharge criterion and ANZECC (2000) Guidelines. These results do not determine compliance, they are used to analyse trends and assist with water management.

Table 14 Water monitoring results

Parameter	Units of measure	EPL 20611 concentration limit during discharge	Dam 1	Dam 2	Dam 3	SW 2	Lot 3
Oil and grease	Milligrams per litre	5 and/or non-visible	<5	<5	<5	<5	<5
pH	pH	6.5 – 8.5	8.87	8.03	8.22	7.41	7.15
Total suspended solids	Milligrams per litre	40	5	<5	<5	<5	26
		ANZECC Guidelines¹					
Conductivity	µS/cm	125 – 2200	876	747	880	560	257
Total dissolved solids	mg/L	--	535	555	610	367	162
Total phosphorus	mg/L	0.025	<0.01	<0.01	<0.01	0.05	0.02
Ammonia	mg/L	0.2	<0.01	<0.01	<0.01	<0.01	<0.01
Nitrogen (Nitrate)	mg/L	0.350	5.47	<0.01	<0.01	<0.01	<0.01
Total hardness (as CaCO ₃)	mg/L	--	113	193	226	62	48
Arsenic	mg/L	0.024	<0.001	<0.001	<0.001	<0.001	<0.001
Cadmium	mg/L	0.0002	<0.0001	<0.0001	<0.0001	<0.0001	<0.001
Calcium	mg/L	--	24	59	74	10	11
Chromium	mg/L	0.001	<0.001	<0.001	<0.001	<0.001	<0.001
Copper	mg/L	0.0014	<0.001	<0.001	<0.001	<0.001	<0.001
Lead	mg/L	0.0034	<0.001	<0.001	<0.001	<0.001	<0.001
Magnesium	mg/L	--	13	11	10	9	5
Manganese	mg/L	1.9	0.015	0.023	0.019	0.661	0.13
Nickel	mg/L	0.011	<0.001	<0.001	<0.001	<0.001	<0.001

Potassium	mg/L	--	2	2	1	2	1
Sodium	mg/L	--	111	61	82	71	26
Vanadium	mg/L	--	<0.01	<0.01	<0.01	<0.01	<0.01
Zinc	mg/L	0.0312	<0.005	<0.005	<0.005	<0.005	<0.005

Note 1 – Key default trigger values presented in ANZECC 2000 for slightly disturbed upland rivers in NSW. Heavy metals based on hard water (120-179 mg CaCO³/L).

5.2 DISCHARGE MONITORING

Condition L2 of the EPL outlines the requirement to monitor water discharges from the Quarry via the licensed discharge points (LDP1, LDP2 and LDP3), see Table 15.

Table 15 EPL20611 - Pollutant concentration limits

Pollutant	Units of Measure	Concentration Limit
Oil and Grease	Visible	5 &/or none visible
pH	pH units	6.5 – 8.5
Total suspended solids	Milligrams per litre	40

5.2.1 Dam 1 (LDP1)

Dam 1 had zero days of discharge during the month of March (see Table 16).

Table 16 Discharge monitoring – LDP1

Date	pH	Total suspended solids	Oil and grease	Controlled
-	-	-	-	-

5.2.2 Dam 2 (LDP2)

Dam 2 had zero days of discharge during the month of March (see Table 17).

Table 17 Discharge monitoring – LDP2

Date	pH	Total suspended solids	Oil and grease	Controlled
-	-	-	-	-

5.2.3 Dam 3 (LDP3)

Dam 3 had zero days of discharge during the month of March (see Table 18).

Table 18 Discharge monitoring – LDP3

Date	pH	Total suspended solids	Oil and grease	Controlled
-	-	-	-	-

6 WEATHER MONITORING

Karuah East Quarry has a permanent meteorological station to monitor various weather parameters including temperature, wind speed/direction, solar radiation, and rainfall. Figure 2 shows the recorded results for the local weather during March 2023.

A wind rose is a graphic tool used to depict the average direction and speed of the wind over a recorded period. Figure 3 shows the wind rose generated from data gathered during March 2023.

Monthly Weather Summary



Site: **Karuah Quarry**

Month: **March 2023**

Date	Day	Temperature @ 2m			Temperature @ 10m			Winds			Solar Radiation		Rain ² mm
		Max ¹ °C	Min ² °C	Ave ¹ °C	Max ¹ °C	Min ² °C	Ave ¹ °C	Max Gust ¹ km/h	Ave Speed ¹ km/h	Dir Ave ¹ deg	Max ¹ W/m ²	Ave ¹ W/m ²	
1	Wed	34.3	19.4	24.3	31.1	19.9	23.5	37.9	6.3	198	933.3	246.8	
2	Thu	29.0	17.6	22.1	26.0	18.2	21.8	28.4	5.2	147	1072.4	234.9	
3	Fri	29.8	15.9	22.5	26.6	16.8	21.8	27.2	4.9	190	1023.3	231.8	
4	Sat	28.9	17.2	21.2	26.1	17.2	20.6	26.0	4.4	160	1035.8	238.7	
5	Sun	33.8	14.5	24.4	30.9	14.9	24.1	27.2	5.1	136	846.6	251.8	
6	Mon	39.1	18.2	28.3	37.6	19.4	28.9	35.5	4.1	154	852.5	249.0	
7	Tue	38.3	19.1	24.2	37.9	20.9	27.1	48.0	4.5	156	853.2	166.0	
8	Wed	29.9	15.9	23.7	29.2	15.9	23.8	35.0	5.1	145	922.1	271.0	
9	Thu	31.3	1.9	22.3	29.2	-20.0	21.9	28.4	4.7	188	862.5	250.9	0.4
10	Fri	29.6	16.1	23.5	27.3	16.9	23.2	35.5	6.0	124	985.0	208.9	
11	Sat	34.3	16.8	25.3	31.4	17.6	24.9	26.0	4.2	165	1045.0	190.8	
12	Sun	31.6	19.3	24.0	27.9	19.8	23.4	43.8	10.1	164	941.7	165.6	
13	Mon	23.7	19.9	20.6	22.9	20.1	20.6	39.0	7.0	177	455.8	74.8	12.4
14	Tue	25.8	18.3	21.1	24.8	18.6	21.0	24.9	2.7	195	1007.4	107.4	2.2
15	Wed	30.8	18.3	22.0	28.3	18.2	21.9	17.8	2.8	189	1045.7	180.3	2.0
16	Thu	36.6	16.7	24.8	35.5	17.4	25.9	26.0	3.4	212	804.1	231.1	
17	Fri	33.8	15.5	24.1	31.4	17.2	23.9	37.9	5.7	159	829.2	239.1	
18	Sat	33.9	17.1	24.6	39.7	17.8	24.6	22.5	4.1	160	796.7	229.9	
19	Sun	40.3	17.2	27.6	37.3	18.5	27.5	26.0	4.7	167	805.7	226.7	
20	Mon	25.5	18.8	22.3	24.9	20.0	22.1	45.0	10.5	155	216.7	32.1	
21	Tue	24.7	19.9	20.2	22.9	19.8	19.9	26.0	4.4	186	740.7	92.6	
22	Wed	27.8	16.2	22.3	26.4	16.9	22.0	28.4	4.5	155	1055.0	169.0	
23	Thu	32.3	18.3	21.3	29.0	18.6	21.0	23.7	3.8	193	982.5	126.2	
24	Fri	28.4	16.9	22.3	25.2	17.3	21.8	28.4	4.3	177	909.9	179.0	22.2
25	Sat	22.9	18.4	19.2	23.3	18.4	19.2	18.9	2.3	183	722.4	62.6	5.4
26	Sun	25.8	17.0	21.1	24.5	17.4	21.2	22.5	3.6	133	895.8	129.3	6.2
27	Mon	21.1	17.3	19.0	21.1	18.0	19.3	20.1	2.5	243	320.0	42.2	
28	Tue	29.4	17.0	21.1	28.0	17.7	21.0	34.3	3.7	216	927.5	120.1	19.2
29	Wed	29.5	18.1	18.9	28.1	18.1	19.5	33.1	3.2	248	896.6	142.3	12.0
30	Thu	25.6	13.1	16.6	24.0	14.3	18.0	30.8	4.6	246	920.7	184.9	10.6
31	Fri	25.3	9.1	16.8	23.9	10.6	17.1	27.2	3.9	204	749.2	204.5	
Ave or Total		30.1	16.6	22.3	28.5	16.5	22.3	30.0	4.7	178.2	853.4	176.8	92.6
High		40.3	19.9	28.3	39.7	20.9	28.9	48.0	10.5		1072.4	271.0	22.2
Low		21.1	1.9	16.6	21.1	-20.0	17.1	17.8	2.3		216.7	32.1	

Notes: 1. Values are for the 24 hour period from 9am to 9am next day.

2. Values are for the 24 hours to 9am.

No. rain days >1mm: 9

Figure 2 Weather Summary - March 2023

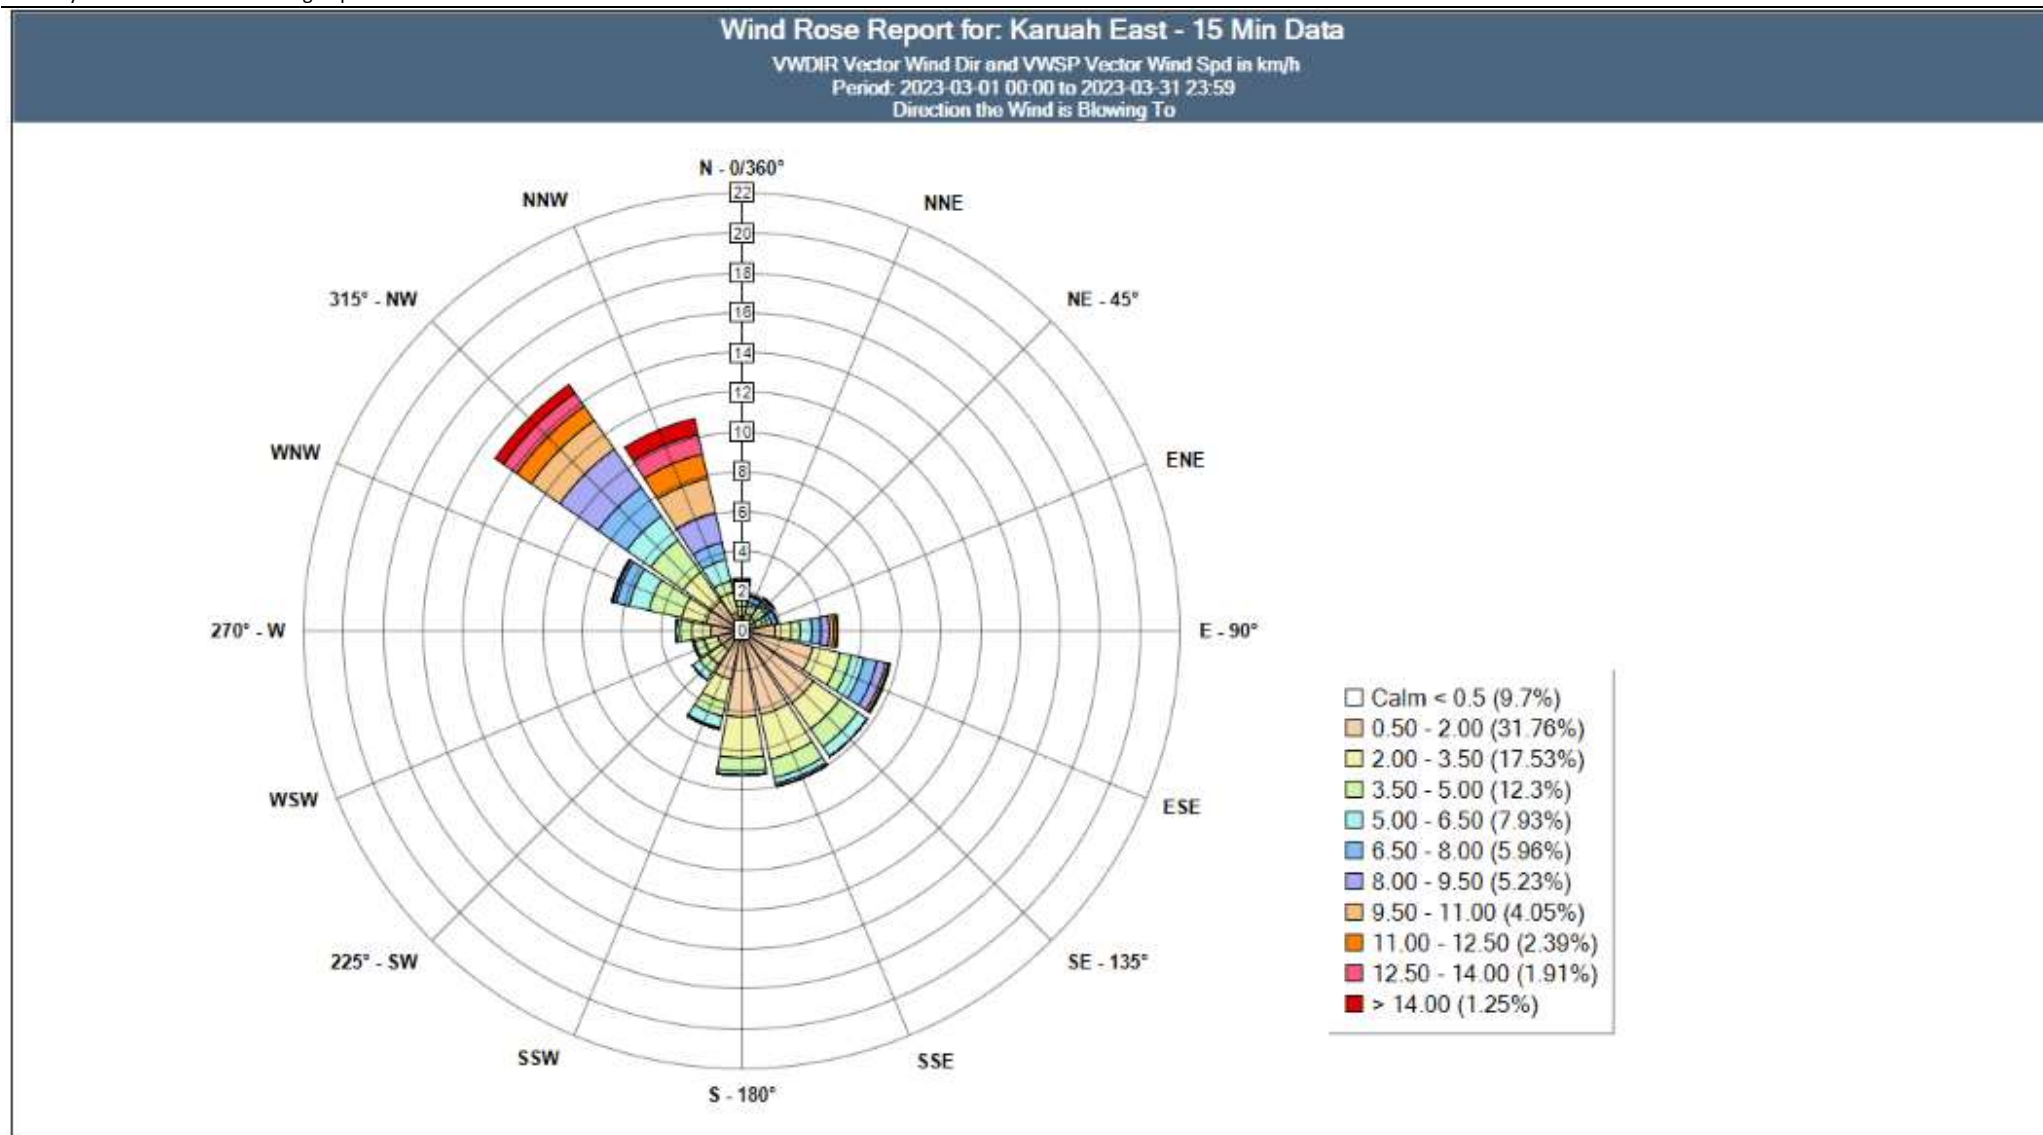


Figure 3 Wind Rose - March 2023

7 REPORTING

7.1 COMMUNITY CONSULTATIVE COMMITTEE

The purpose of a Community Consultative Committee (CCC) is to provide a forum for discussion between a proponent (KEQPL) and representatives of the community, stakeholder groups and the local council on issues directly relating to a specific State Significant Project (KEQ).

The KEQ CCC generally meets biannually (twice a year). Meeting minutes can be found at Hunter Quarries website <<https://hunterquarries.com.au/>>.

On 19 March, the first KEQ CCC meeting for 2023 was held, below are the key details:

- A site inspection was undertaken with three KEQPL representatives and five community representative.
- The meeting was facilitated at the Karuah RSL with one chairperson, five community representatives and three KEQPL representatives.
- The next CCC meeting is scheduled for September 2023.

7.2 PRODUCTION

For the month of March 61,645 tonnes of various quarry products were produced.

7.3 NON-COMPLIANCE

There were nil non-compliance event during March 2023 to report (see Table 19).

Table 19 Non-compliance Register

Date	Nature of Incident	Action
March 2023	Nil complaints received	Nil action required

7.4 COMPLAINTS

There were nil complaints received during March 2023 (see Table 20).

Table 20 Complaints Register

Date	Nature of Complaint	Action
March 2023	Nil complaints received	Nil action required

Appendix 1 – Monitoring Locations

Karuah East Quarry

Monitoring Locations

Legend

- Attended Noise
- Dust Deposition
- Groundwater
- High Volume Air Samplers
- Surface Water
- Unattended Noise



Google Earth

Image © 2019 CNES / Airbus

© 2018 Google

900 m