

Karuah East Quarry ABN: 80 141 505 035 Karuah East Quarry Pty Limited Blue Rock Close, Karuah NSW 2324 W: www.hunterquarries.com.au E: admin@hunterquarries.com.au T: 02 4050 0304 P: PO Box 23, Thornton NSW 2322

Karuah East Quarry

Environmental Monitoring Report

March 2024





Contents

Conte	nts		2	
1.0	Introd	luction	3	
2.0	2.0 Air Quality Monitoring			
	2.1	Deposited Dust Monitoring		
	2.2	High Volume Air Sampling	5	
3.0	Blast I	Monitoring	7	
4.0	Noise Monitoring			
5.0	Surface Water Monitoring			
6.0		ner Station Monitoring		
7.0	Produ	ction Data	10	
8.0	Repor	ting	10	
	8.1	Reportable Environmental Incidents	10	
8.2 Reportable Non-Compliances		Reportable Non-Compliances	10	
	8.3	Community Complaints	10	
Appei	ndix 1 –	EPL 20611 Monitoring Locations	11	



1.0 Introduction

This report has been completed to meet the requirements of Section 66(6) of the *Protection of the Environment Operations Act 1997* and the NSW Environmental Protection Authority's (EPA) Requirements for Publishing Pollution Monitoring Data (EPA, 2013). This report summarises the required monitoring data under Environmental Protection Licence 20611 (the EPL) and Project Approval MP09_0175 (the Consent) for the Karuah East Quarry (the Quarry) as summarised by **Table 1** and **Table 2** respectively.

Table 1 Summary of Environment Protection Licence, EPL 20611

, ,	
EPL Number:	EPL 20611
Licensee's Name:	Karuah East Quarry Pty Limited
	Karuah East Quarry
Licensee's Address:	PO Box 3284, Thornton NSW 2322
	Blue Rock Close, Karuah NSW 2324
Link to Full Licence on the EPA website:	EPL 20611

Table 2 Summary of Project Approval, MP09_0175

Project Approval:	MP09_0175
Applicant:	Karuah East Quarry Pty Limited
Consent Authority:	NSW Planning Assessment Commission
Link to Full Project Approval on the NSW Planning website:	Project Approval MP09_0175

A summary of the environmental monitoring data for the March 2024 reporting period (the Reporting Period) is covered in this report. Tables throughout this report provide key monitoring information from the EPL and the Consent, including:

- location of monitoring;
- pollutant;
- unit of measurement; and
- monitoring frequency required.

Monitoring locations are illustrated by the site plan provided by **Appendix 1**.



2.0 Air Quality Monitoring

Dust emissions generated by the Quarry operation must not cause additional exceedances of ambient air quality criterion outlined in Schedule 3, Condition 13 of the Consent and summarised by **Table 3**, **Table 4** and **Table 5**.

Deposited dust and TSP/PM10 monitoring is undertaken at the locations listed in **Table 6**, in accordance with the Approved Methods of Sampling and Analysis of Air Pollutants in NSW (EPA, 2022).

Table 3 Long-term Assessment Criteria for Deposited Dust (MP09-0175).

Pollutant		Averaging Period	Maximum Increase in Deposited Dust Level ¹	Maximum Total Deposited Dust Level ¹	
	Deposited Dust	Annual	2 g/m²/month	4 g/m²/month	

¹ Deposited dust is assessed as insoluble solids as defined by AS 3580.10.1-2003.

Table 4 Long-term Assessment Criteria for Particulate Matter (MP09-0175).

Pollutant	Averaging Period	Criterion
Total Suspended Particulates	Annual	90 μg/m³
Particulate Matter < 10 μm (PM10)	Annual	30 μg/m³

Table 5 Short-term Assessment Criteria for Particulate Matter (MP09-0175).

Pollutant	Averaging Period	Criterion
Particulate Matter < 10 μm (PM10)	24-hour	50 μg/m³

Table 6 Air Quality Monitoring Locations (EPL 20611).

Site Monitoring Point ID	EPL Monitoring Point ID	Location	Address	Coordinates
DDG 1	4	South-West of	54 Mill Hill Close,	32°38′04″S
DDG 1	4	Karuah East Quarry	Karuah NSW 2324	151°59′58′′E
DDG 2	_	South-West of	64 Mill Hill Close,	32°38′02″S
DDG 2	5	Karuah East Quarry	Karuah NSW 2324	152°00′09′′E
DDC 3	6	South-West of	Lot 251 DP1092111,	32°37′57″S
DDG 3		Karuah East Quarry	Karuah NSW 2324	151°59′41′′E
DDG 4	7	East of	21 Halloran Road,	32° 37' 30.87"S
DDG 4	64 /	Karuah East Quarry	North Arm Cove NSW 2324	152°01'10.18"E
DDC F	8	South-West of	Lot 21 DP1024341,	32° 37' 55.33"S
DDG 5	٥	Karuah East Quarry	Karuah NSW 2324	152°00'2.74"E
LIVAC	0	South-West of	64 Mill Hill Close,	32°38′03″S
HVAS	9	Karuah East Quarry	Karuah NSW 2324	152°00′09′′E



2.1 Deposited Dust Monitoring

Deposited dust results for the 12-months prior-to and including March 2024 are summarised by **Table 7**.

Table 7 Deposited dust monitoring results.

- abie / Esposited data monitoring results.								
Reporting Period	Start Date	End Date	Days	DDG 1 EPL ID 4	DDG 2 EPL ID 5	DDG 3 EPL ID 6	DDG 4 EPL ID 7	DDG 5 EPL ID 8
Apr-23	05/04/2023	04/05/2023	29	0.3	0.5	0.3	0.2	1.2
May-23	04/05/2023	05/06/2023	32	0.2	0.3	0.3	0.4	0.4
Jun-23	06/06/2023	04/07/2023	28	0.6	2.5	1.8	-	_
Jul-23	04/07/2023	03/08/2023	30	0.4	0.9	1.2	1.1	0.3
Aug-23	03/08/2023	04/09/2023	32	0.7	0.3	0.5	0.5	0.2
Sep-23	04/09/2023	04/10/2023	30	1.5	2.6	1.4	1.4	2.0
Oct-23	04/10/2023	02/11/2023	31	1.4	2.4	2.2	1.6	2.5
Nov-23	02/11/2023	30/11/2023	28	1.6	-	1.4	1.0	2.0
Dec-23	30/11/2023	28/12/2023	28	1.1	1.0	1.3	1.3	1.7
Jan-24	28/12/2023	25/01/2024	28	1.4	1.2	1.0	1.2	1.7
Feb-24	25/01/2024	26/01/2024	32	1.1	0.8	1.3	1.3	1.3
Mar-24	26/02/2024	28/03/2024	31	0.8	0.9	1.8	0.6	1.8
Pr	Progressive Annual Average			0.9	1.2	1.2	1.0	1.4

Monitoring results for the Reporting Period at all five DDG monitoring sites are within the long-term annual deposited dust limit of $4 \text{ g/m}^2/\text{month}$.

It should be noted that DDG 4 and DDG 5 samples in the June 2023 reporting period, and DDG 2 sample in the November 2023 reporting period become contaminated with vegetation matter and are therefore discounted from averaging. These two 'failure to monitor events'; was reported to the NSW Department of Planning, Housing & Infrastructure (NSW Planning), the NSW EPA and surrounding landholders in accordance with the relevant conditions of the Consent and EPL.

2.2 High Volume Air Sampling

TSP and PM10 results for the Reporting Period are summarised by **Table 8** and illustrated respectively by **Figure 1** and **Figure 2**.

Table 8 HVAS TSP and PM10 monitoring results for the Reporting Period.

Run Date	Total Suspended Particulates, TSP (µg/m³)	Particulate Matter < 10 μm, PM10 (μg/m³)
06/03/2024	40	14
12/03/2024	41	17
18/03/2024	12	4
24/03/2024	10	4
30/03/2024	8	3
Monthly Average	22.2	8.4

Monitoring results for the five HVAS run days within the Reporting Period were compliant with the long-term limits for TSP and PM10 and short-term limits for PM10.

Page
5 of 12



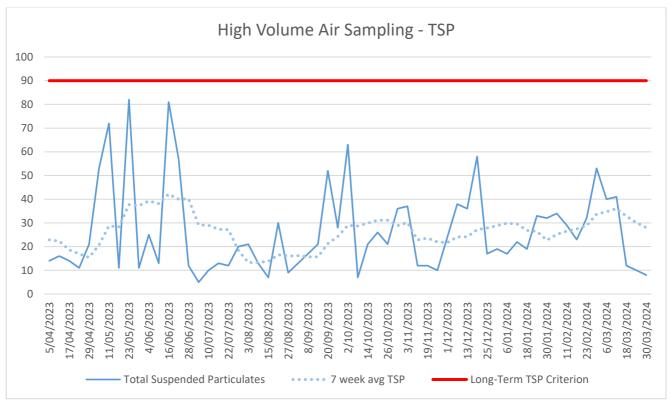


Figure 1 Long-term TSP monitoring trends.

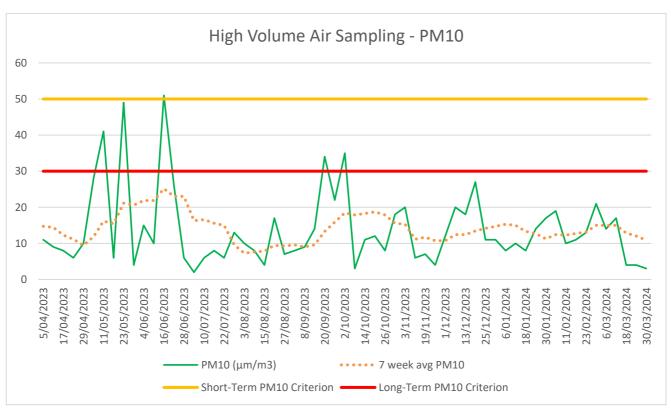


Figure 2 Long-term PM10 monitoring trends.

	rage	
	6 of 12	
·	-	



3.0 Blast Monitoring

Blast monitoring is undertaken for all blasts at the Quarry at the nearest residential location (EPL Monitoring Point 11) to ensure that air blast overpressure and ground vibration remain within the compliance limits, as summarised by **Table 9**; with the monitoring results summarised by **Table 10**.

There was one blast within the Reporting Period and was observed to be within compliance limits.

Table 9 Blasting Airblast Overpressure and Ground Vibration Criteria (MP09-0175 & EPL 20611).

Location	Airblast Overpressure (dB(L))	Ground Vibration (mm/s)	Allowable Exceedance
Private Residence B	120	10	0%
EPL Monitoring Point ID 11	115	5	5% over 12-month reporting period.

Table 10 Blasting Monitoring Results.

Date	Time	Location	Airblast Overpressure (dB(L))	Ground Vibration (mm/s)	
11/03/2024	13:57	RL 105	112.4	0.60	

*Not triggered = n/t Ground Vibration < 0.5 mm/s Overpressure < 108 dB(L)

4.0 Noise Monitoring

Noise monitoring is undertaken in accordance with the EPL and NSW Planning approved Noise Management Plan, which requires attended noise monitoring to be conducted on a quarterly basis.

During the Reporting Period, no noise monitoring was completed.

Page							
7 of 12							



5.0 Surface Water Monitoring

Water monitoring is undertaken in accordance with the EPL and NSW Planning approved Water Management Plan, with daily monitoring of surface water being discharged from the Quarry via the licenced discharge points in accordance with Condition L2 and M2 of the EPL.

Discharge events that occurred during the Reporting Period are summarised by **Table 11**.

Table 11 Discharge Water Monitoring Results.

Tuble 11 Districting water World Newscarts.									
Date	рН	Turbidity (NTU)	Total Suspended Solids, TSS (mg/L)	Oil and Grease	Discharge Type				
LDP 1 – Dam 1									
-	-		-	-	-				
	LDP 2 – Dam 2								
08/03/2024	7.8	5.8	5	5 NV Controlle					
18/03/2024	7.6	27	26 NV		Controlled				
25/03/2024	25/03/2024 8.8 5.2 9		9	NV Controlled					
	LDP 3 – Dam 3								
04/03/2024	7.2	5.6	<5	NV	Controlled				
05/03/2024	7.3	4.1	<5	NV	Controlled				
18/03/2024	7.3	7.0	7 NV		Controlled				
19/03/2024	7.7	5.1	5 NV		Controlled				
28/03/2024	7.7	12	8	NV	Controlled				
29/03/2024	8.6	4.9	6 NV Co		Controlled				



6.0 Weather Station Monitoring

The Quarry operates and maintains a permanent meteorological monitoring station to record weather parameters including temperature, wind speed and direction, solar radiation and rainfall. **Figure 1** below outlines the weather records for the Reporting Period.

		Monthly Weather Summary							ПER				
Site:							QUARRIES						
Month	:	March 20	24										
		Temperature @ 2m			Temperature @ 10m			Winds		Solar Radiation		Rain²	
Date	Day	Max ¹	Min²	Ave ¹	Max ¹	Min²	Ave ¹	Max Gust ¹	Ave Speed ¹	Dir Ave ¹	Max ¹	Ave ¹	Naiii
		*C	°C	*C	°C	*C	*C	km/h	km/h	deg	W/m²	W/m²	mm
1	Fri	40	22.3	28.9	38.7	23.3	28.9	32.3	5.8	227.5	792.5	227	6.6
2	Sat	32.8	23.7	26.9	30.3	24	26.5	18.4	3.8	171.6	845.8	179.5	0
3	Sun	32.2	19.6	23.1	31.8	19.7	23	21.3	4.1	207.1	760.7	82.5	15.8
4	Mon	30.8	19.8	24.4	28.9	20.1	24.1	24.6	6.3	162.2	1081.6	183.2	0
5	Tue	27	13.6	20.1	24.1	14.1	19.9	21.4	5.9	177.7	990.8	134	0
6	Wed	27.8	14.9	20.7	25.4	15.6	20.7	18.9	4.2	154.4	933.2	162.4	0.2
7	Thu	32.6	17.2	23.7	30.4	18.1	23.5	14	3.5	160.8	818.3	227.8	0
8	Fri	33.7	17.5	24	30.5	18	23.6	19.3	3.9	162.5	792.5	225.4	0
9	Sat	31.3	16.3	22.9	28.5	17.1	22.9	20.4	3.7	170	965.7	192.5	0
10	Sun	30.3	16.2	22.6	27.9	16.7	22.4	22.9	4.3	170.8	907.4	207.4	0
11	Mon	30.9	16.1	22.7	28.5	16.9	22.7	23.5	4.2	150.8	1039.2	185.2	0
12	Tue	31.5	15.3	22.5	29.4	16.5	22.5	20.2	4.5	163.7	953.3	199.2	0
13	Wed	34.6	14.1	22.8	32.2	14.9	22.7	13.7	3	188.1	799.2	233.9	0
14	Thu	30.5	16	22.1	27.8	16.6	22.1	23	4.4	168.3	1034.2	176.3	0
15	Fri	36.2	19.5	25.5	34.2	19.6	25.1	23.2	7.4	186.7	747.5	205	4
16	Sat	26.4	15	20.7	24.6	15.8	20.6	28.1	7.4	178.5	1040	149	0
17	Sun	24.9	17	20.7	23.8	17	20.6	18.1	3.6	164.7	820	100.1	7.6
18	Mon	24.1	16.3	18.9	23.4	16.5	18.8	15.3	2.8	170.6	895.7	96.9	9
19	Tue	24.7	17	19.7	23.6	17.3	19.7	15.6	3	172.4	831.7	82.8	4.8
20	Wed	30.4	18.8	23.7	28.2	19.6	23.6	17.2	4.6	142.8	923.3	182.6	0.2
21	Thu	26.5	18	21	25.6	18.3	20.9	26.4	8.3	172.5	392.5	46.1	7.2
22	Fri	25.1	15.7	19.3	22.1	15.5	18.7	23.5	5.7	202.6	1044.1	192.4	5.4
23	Sat	24.3	12.3	17.4	23	12.9	17.7	16	2.9	184.2	992.5	138.7	0.2
24	Sun	25.5	16	19.5	24.1	16.1	19.4	15.1	2.8	191.5	725.7	115.5	0
25	Mon	28.1	14	19.5	25.8	14.8	19.5	13.7	3.2	160.5	905	154.5	0.2
26	Tue	31.4	13.6	21.2	28.6	14.7	21.4	15.7	3.1	150.8	818.3	187.1	0
27	Wed	30.6	14.6	20.4	27.9	14.9	20.4	17.6	3.6	172	786.7	175.3	0.8
28	Thu	26.6	15.9	20	25.1	16.3	19.9	18	3.4	183.5	979.2	123	8.8
29	Fri	25.4	17.8	20.4	23.9	18	20	18.3	4.3	168.2	956.6	129.7	0.2
30	Sat	24.6	13.6	18.2	23.4	13.9	18.4	10.5	1.9	157.6	705	84.6	0.4
31	Sun	28.6	13.6	19.6	26.8	13.7	19.7	16.5	3.3	166.6	804.2	174.4	0.2
Ave or Total 29.3 16.5 21.7 27.4 17.0 21.6 19.4 4.3 172.9 873.6 159.8 71.6							71.6						
Hig	gh	40.0	23.7	28.9	38.7	24.0	28.9	32.3	8.3	_	1081.6	233.9	15.8
Lo	w	24.1	12.3	17.4	22.1	12.9	17.7	10.5	1.9	$\overline{}$	392.5	46.1	
Notes:	1. Value	s are for the 24	hour period fro	m 9am to 9am r	next day.						No. rain d	ays >1mm:	9

Figure 1 Weather Records Summary during the Reporting Period.

2. Values are for the 24 hours to 9am.



7.0 Production Data

Monthly monitoring of sales and truck movements are summarised by **Table 12**.

Table 12 Quarry Production Data.

Month	Truck Movements	Quarry Product Sales (t)
Jan-24	3,559	109,693
Feb-24	2,649	82,999
Mar-24	3,003	92,042

8.0 Reporting

8.1 Reportable Environmental Incidents

During the Reporting Period, no reportable environmental incidents occurred at the Quarry.

8.2 Reportable Non-Compliances


During the Reporting Period, no reportable non-compliances were identified at the Quarry.

8.3 Community Complaints

During the Reporting Period, no community complaints were reported to the Quarry.



Appendix 1 – EPL 20611 Monitoring Locations

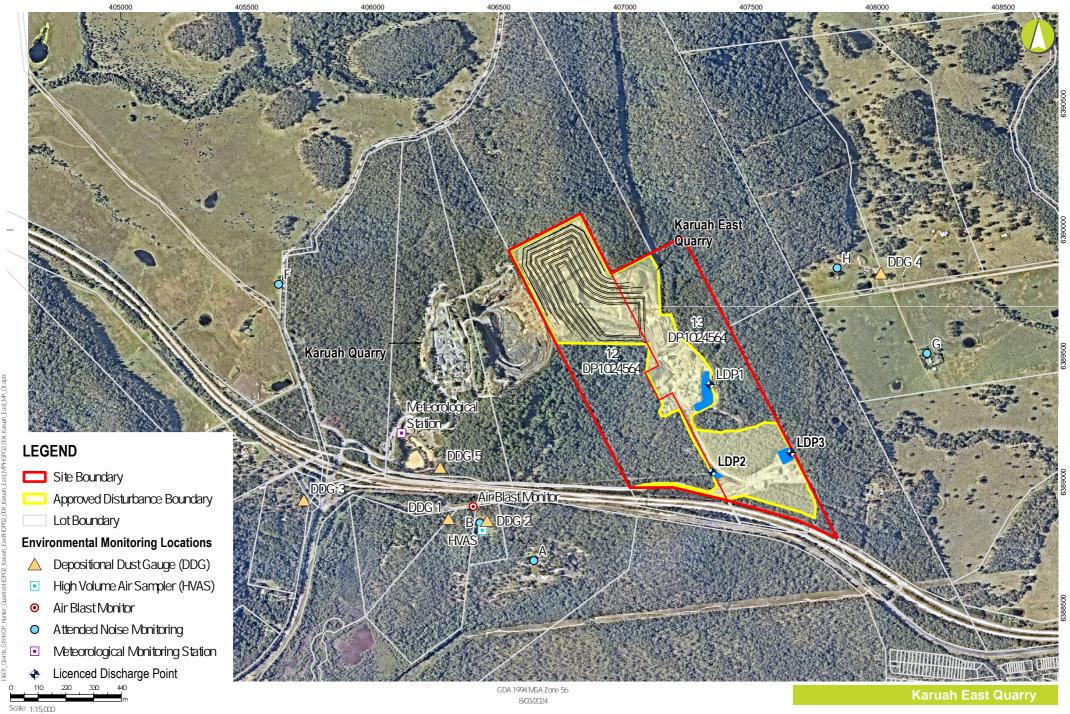

Environmental Monitoring Report
APPENDIX 1 - Environmental Monitoring Locations